



H10C**X302

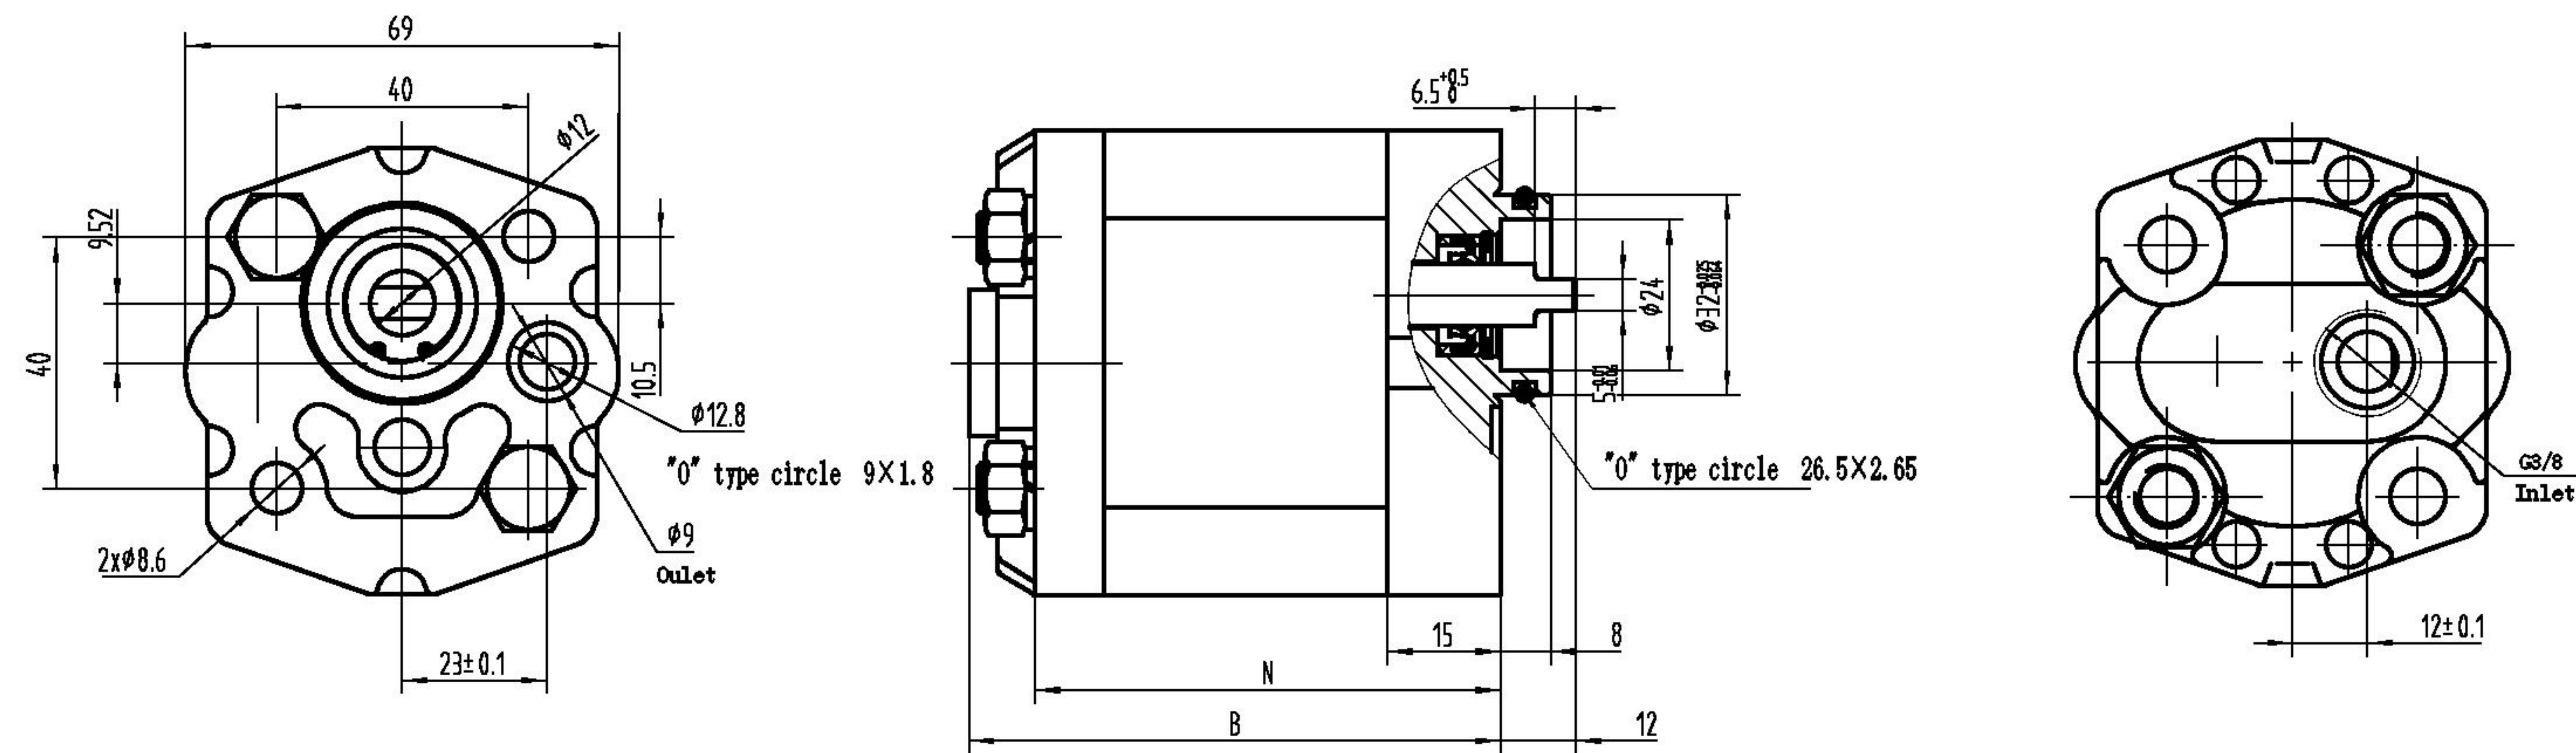

H10A**X302

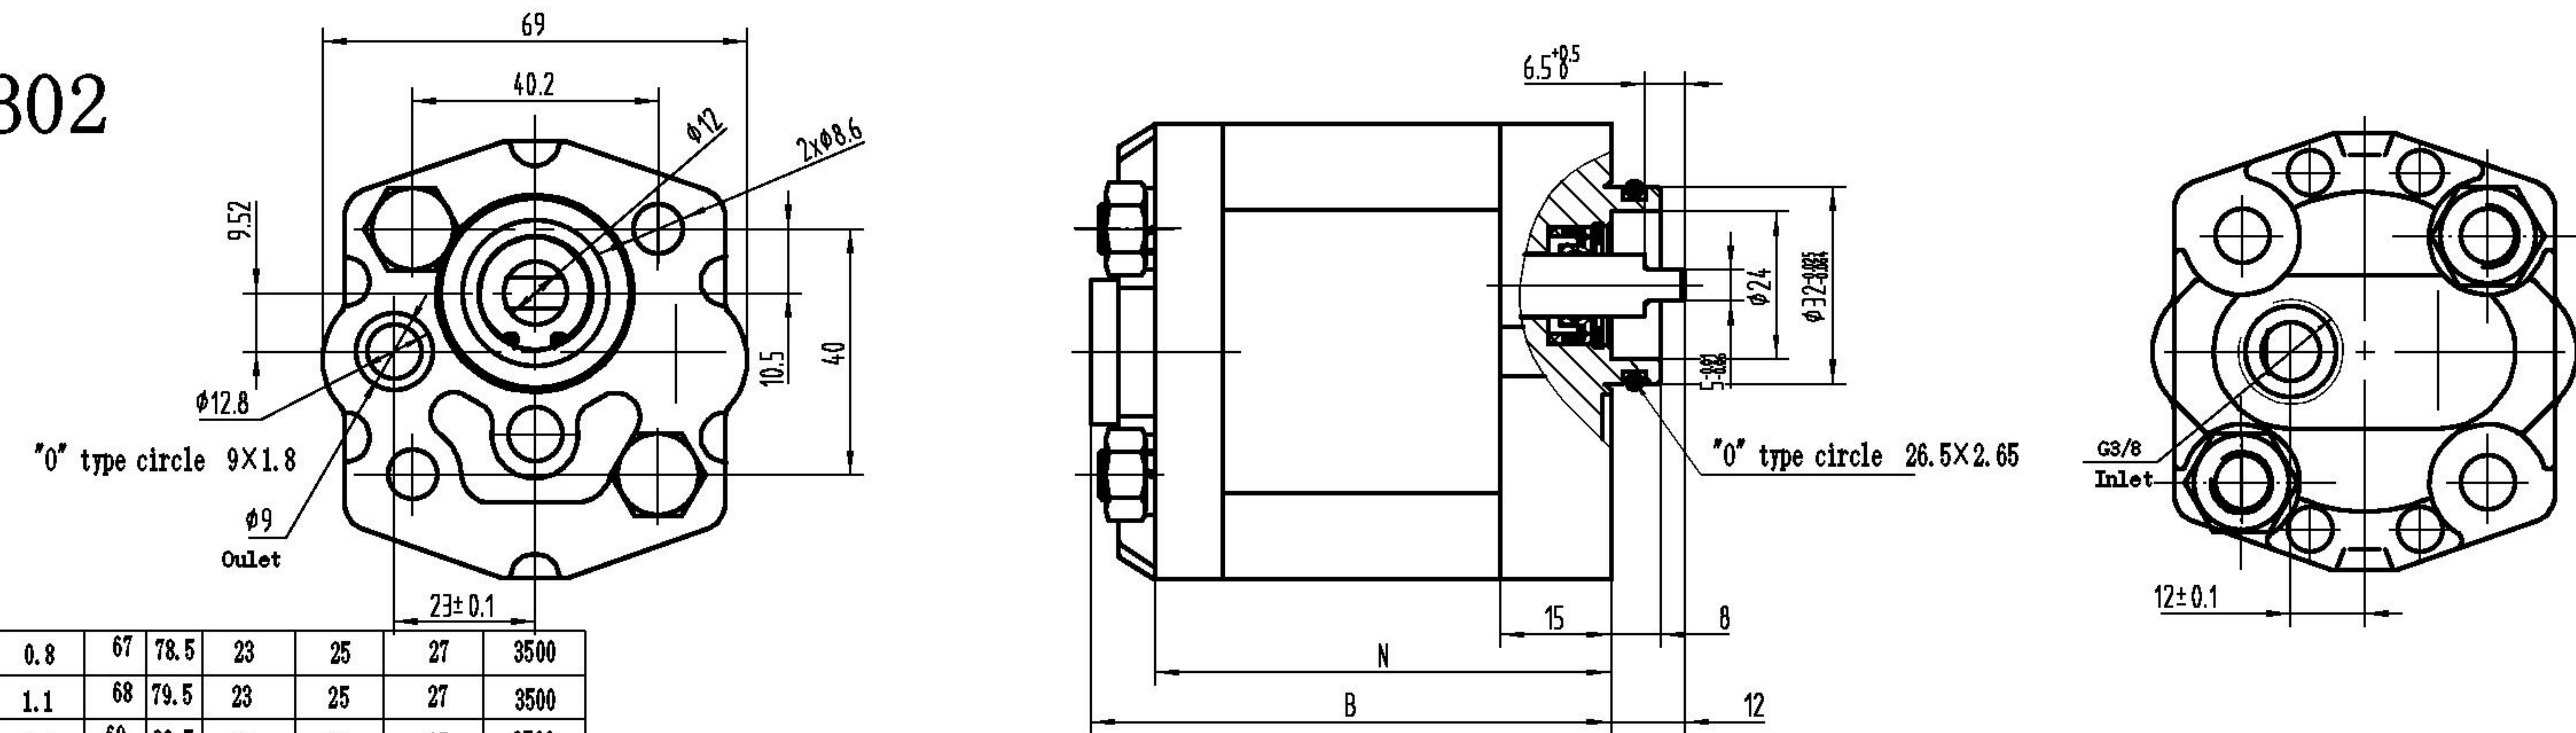

	10A(C)0.8×302	0.8	67	78.5	23	25	27	3500
	10A(C)1.1×302	1.1	68	79.5	23	25	27	3500
	10A(C)1.3×302	1.3	69	80.5	23	25	27	3500
	10A(C)1.6×302	1.6	70.5	82	23	25	27	3500
	10A(C)1.8×302	1.8	71.5	83	23	25	27	3500
	10A(C)2.1×302	2.1	72	83.5	23	25	27	3500
	10A(C)2.5×302	2.5	74	85.5	23	25	27	3500
	10A(C)2.7×302	2.7	74.5	86	23	25	27	3500
	10A(C)3.2×302	3.2	77	88.5	21	23	25	3500
	10A(C)3.7×302	3.7	78.5	90	20	23	25	3500
	10A(C)4.2×302	4.2	81	92.5	20	23	25	3500
	10A(C)4.8×302	4.8	83	94.5	19	21	23	3500
	10A(C)5.0×302	5.0	84	95.5	19	21	23	3000
	10A(C)5.7×302	5.7	86.8	98.3	19	21	23	3000
	10A(C)5.8×302	5.7	86.8	98.3	19	21	23	3000
	10A(C)6.1×302	6.1	87.5	99	18	20	22	2500
	10A(C)6.3×302	6.3	88	99.5	15	17	19	2500
	10A(C)6.5×302	6.5	88.5	100	15	17	19	2500
	10A(C)7.0×302	7	90.5	102	13	15	17	2500
	10A(C)8.0×302	8	94.5	106	12	14	16	2000
	10A(C)9.0×302	9	98.5	110	10	12	14	2000
	Model	Displacement ml/r	N	B	P1 Max. Pressure	P2 (MPa)	P3	Max. Speed r/min